


Portable UV Radiometer 7.1 (for UVB)

GUVB-T11GS7.1-LA9 (External Sensor Probe)



Description : Portable UVB Intensity Measurement

Function & Display : Absolute Power (mW/cm^2), Dose (J/cm^2), Max Power (mW/cm^2)

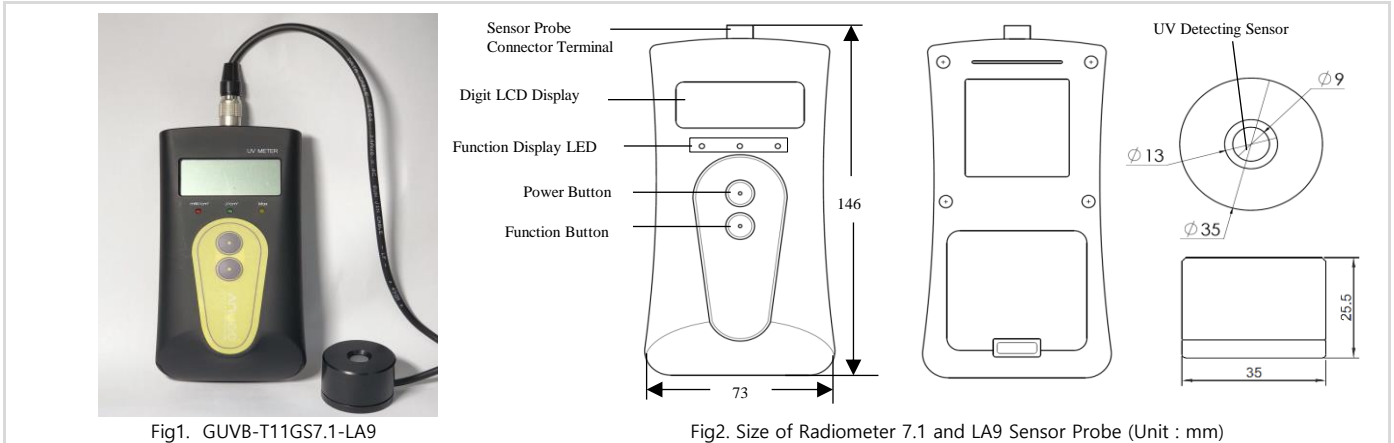

Features and Applications

Features	Applications
<ul style="list-style-type: none"> - 4.0 digit LCD display - Detachable LA9 Sensor Probe (Push-Pull connector) - Absolute Power, Dose and Max Power displayed 	<ul style="list-style-type: none"> - UVB Intensity Measurements - UVB Light Transmittance Measurements - Portable UVB Intensity Meter

UV Radiometer Dimensions

Height(mm)	Width(mm)	Thickness(mm)	Weight(g)	Material
146	73	31	100 (without batt.)	ABS

Sensor probe Dimensions

Size(mm)	Window(mm)	Cable length(m)	Weight(g)	Material
Ø35, H25.5	Ø9	1	80	AL-60

Absolute Maximum Ratings

Parameter	Min.	Typ.	Max.	Unit	Remark
Storage Temperature	0		60	°C	
Operating Temperature	0		50	°C	
Operating Humidity	10		85	% RH	
Battery		9		VDC	DC 9V (6LR61/6F22)


Electro-Optical Characteristics (at 25°C)

Parameter	Min.	Typ.	Max.	Unit	Remark
Detection Range	220		320	nm	10% of R_{peak}
Detection Power Range*	0		100.0	mW/cm^2	

*Customized available (Maximum of detection power : $10\text{W}/\text{cm}^2$)

(NIST Traceable)

Relative Responsivity

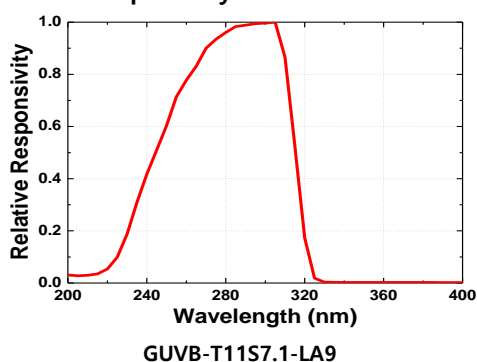

Power button(on/off)
-> Push Power button over 3 seconds

Mode button
-> Change display mode
Absolute Power (mW/cm^2) → Dose (J/cm^2) → Max Power (mW/cm^2) → Absolute Power(mW/cm^2).....



UV Detecting Sensor

